

Unifloor B.V. Soundlab, Lubeckstraat 12, 7418 EV Deventer

Unifloor B.V.
Arnsbergstraat 4
7418 Deventer
The Netherlands

Unifloor B.V.

Soundlab
Lubeckstraat 12
7418 JV
Deventer

T:+31 0570 553322
E: f.vousten@unifloor.nl

Powered by:



Test Order: Laboratory measurement of impact sound insulation of building elements according DIN EN ISO 10140-3:2015-11

Order date : 1 juni 2023

Sample description : Test op vaste zandcement vloer

Number of samples : N/A

Sampling : by client

Sample receipt :

Test period : 9 juni 2023

Deventer, 14 juli 2023

A handwritten signature in black ink, appearing to read "F. Vousten".

F. Vousten

Laboratory Manager

The test results relate only on the items tested. Without the written approval of the testing laboratory, a duplication in extracts of the test report is not permitted.

1 Product Description

Product Description (Construction from top to bottom)

* customer information

Position	Description	Thickness [mm]	Weight [kg/m ²]
1	Redupanel	25	15,2
2	Cocofloor 4mm	4	0,65
3	PE folie	0,002	-

Illustration / drawing for sample assembly



2 Scope of testing / Annexes

No.	Annex	Designation	Standard	Pages general	Pages evaluation
1	TS	Impact Sound Insulation	DIN EN ISO 10140-3:2015-11	2	1

General Annex TS for laboratory impact sound tests

1 Test stand description

Test rooms: Laboratory Unifloor B.V., Lubeckstraat 12, 7418 EV, Deventer
 Sending room: 8,0 m x 4,0 m x 2,50 m; V = 80 m³ (cubic, with diffusers)
 Receiving room: 4,0 m x 4,0 m x 3,13 m; V = 50,8 m³ (cubic, with diffusers)
 Reference ceiling: 4,0 m x 4,0 m; S = 16 m²
 14 cm concrete solid plate ceiling with an area-related mass m' ≈ 322 kg/m²

2 Analysis

The impact sound levels generated by the standardized tapping machine are measured in the receiving room under a solid ceiling without and with the floor covering. From the measured values the reduction of impact sound pressure is calculated as follows:

$$\begin{aligned}
 \Delta L &= L_{n,0} - L_n \text{ in dB} \\
 L_{n,0} &= \text{Impact sound level without floor covering in dB} \\
 L_n &= \text{Impact sound level with floor covering in dB}
 \end{aligned}$$

To determine the weighted impact sound reduction the applicable reference curve is shifted in 1 dB steps into the measured curve so that the sum of the most unfavorable deviations corresponds as close as possible to the value of 32 dB without exceeding this value.

The linear impact sound level ΔL_{lin} you can calculate after the following equation:

$$\Delta L_{lin} = L_{n,r,0,w} + C_{I,r,0} - (L_{n,r,w} + C_{I,r}) = \Delta L_w + C_{I,\Delta}$$

$L_{n,r,w}$	the calculated weighted norm impact sound level of the cover blanket with the blanket edition to be checked is.
$L_{n,r,0,w}$	78 dB, investigates $L_{n,r,0}$ to 4.3.1 DIN EN ISO 717-2:2021-05.
$C_{I,r}$	Spectrum customization value.
$C_{I,r,0}$	Spectrum customization value.

2.1 Test Standards

Standard: (Issue)	Title
DIN EN ISO 10140-1:2016-12	Akustik – Messung der Schalldämmung von Bauteilen im Prüfstand – Teil 1: Anwendungsregeln für bestimmte Produkte
DIN EN ISO 10140-2:2010-12	Akustik – Messung der Schalldämmung von Bauteilen im Prüfstand – Teil 2: Messung der Luftschalldämmung
DIN EN ISO 10140-3:2015-11	Akustik – Messung der Schalldämmung von Bauteilen im Prüfstand – Teil 3: Messung der Trittschalldämmung
DIN EN ISO 10140-4:2010-12	Akustik – Messung der Schalldämmung von Bauteilen im Prüfstand – Teil 4: Messverfahren und Anforderungen
DIN EN ISO 10140-5:2014-09	Akustik – Messung der Schalldämmung von Bauteilen im Prüfstand – Teil 5: Anforderungen an Prüfstände und Prüfeinrichtungen

2.2 Evaluation Standards

Standard: (Issue)	Title
DIN EN ISO 717-2:2021-05 ²	Akustik – Bewertung der Schalldämmung in Gebäuden und von Bauteilen – Teil 2: Trittschalldämmung
DIN EN ISO 12999-1:2021-04 ²	Akustik - Bestimmung und Anwendung der Messunsicherheiten in der Bauakustik - Teil 1: Schalldämmung
ASTM E989 – 18 ³	Standard Classification for Determination of Single-Number Metrics for Impact Noise
ASTM E2179 - 03(2016) ³	Standard Test Method for Laboratory Measurement of the Effectiveness of Floor Coverings in Reducing Impact Sound Transmission Through Concrete Floors

² german issue

³ american issue

3 Note

The results are based on measurements performed under laboratory conditions with artificial excitation (standard procedure). The test results are applicable in due consideration of the national provisions and the local circumstances and/or constructions.

Contactgeluidreductie test volgens ISO 10140-1

Annex TS - ΔL_w

Laboratoriummeting van contactgeluidreductie op een standaard test vloer met vloerafwerking
Annex TS – Impact sound insulation

Testdatum 9-6-2023

Opbouw (kaal)
(van boven naar beneden) Redupanel 25mm
Cocofloor 4mm
PEfolie

Remarks:

Zendruimte:

Volume: 90,0 m³

Boundary conditions:

Aantal posities hamerslagapparatuur 4

Ontvangstruimte:

Volume: 50,0 m³

Aantal posities microfoon: 1


Temperatuur: 20,5 °C

Klasse vloer II

Luchtvochtigheid: 51,0 %

Type referentievloer: Heavyweight

Frequency f [Hz]	$L_{n,0}^{*}$ 1/3 oct. [dB]	ΔL 1/3 oct. [dB]
50	59,0	3,4
63	64,0	3,1
80	62,4	1,2
100	67,9	1,1
125	75,2	-2,3
160	75,9	-1,8
200	74,0	-1,1
250	67,9	4,8
315	63,4	10,8
400	59,1	16,2
500	57,0	20,8
630	53,4	25,7
800	49,4	29,7
1000	44,5	34,5
1250	40,5	38,3
1600	36,4	41,8
2000	31,1	46,7
2500	23,9	53,4
3150	16,3	59,3
4000	11,9	61,2
5000	10,7	58,3

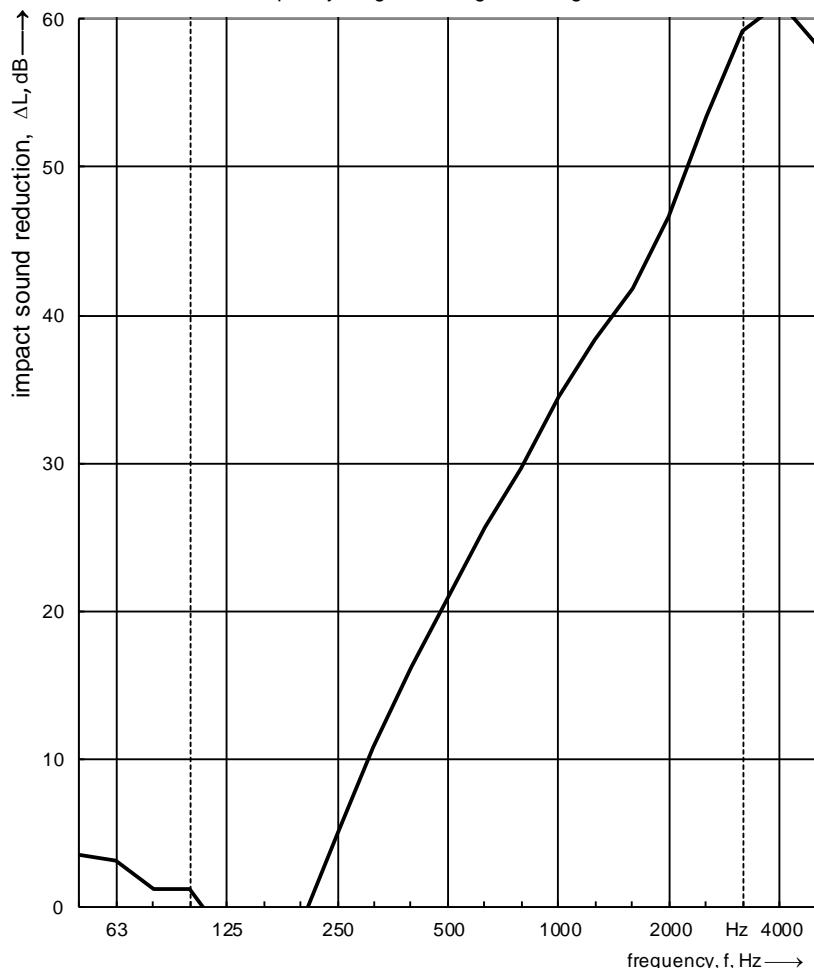

*) informative, without room correction

Evaluation according to ISO 717-2

$$\Delta L_w = 18 \text{ dB}$$

$$C_{i,\Delta} = -12 \text{ dB}$$

$$C_{i,r} = 1 \text{ dB}$$

$$\Delta L_{lin} = 6 \text{ dB}$$

The results are based on measurements, which were performed under laboratory conditions with artificial excitation (standard procedure).

Testrapport nummer

UF 2702_101-1 Redupanel CocoFloor 4mm

unifloor
Research & Development